

sanding). The unsafe condition, if not addressed, could result in fatigue cracks and fracture of the tail rotor slider assembly, resulting in failure of the tail rotor controls and consequent loss of yaw control of the helicopter.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2018–0292.

(h) Exceptions to EASA AD 2018–0292

(1) Where EASA AD 2018–0292 refers to flight hours (FH), this AD requires using hours time-in-service.

(2) Where EASA AD 2018–0292 refers to its effective date, this AD requires using the effective date of this AD.

(3) Where EASA AD 2018–0292 refers to “Part I of the ASB,” this AD requires using “Part I of section 3., Accomplishment Instructions of the ASB,” and where EASA AD 2018–0292 refers to “Part II of the ASB,” this AD requires using “Part II of section 3., Accomplishment Instructions of the ASB.”

(4) Where the service information referred to in EASA AD 2018–0292 specifies to return certain parts, this AD does not include that requirement.

(5) Where the service information referred to in EASA AD 2018–0292 specifies to contact Leonardo S.p.a. “if in doubt” regarding if a tail rotor slider assembly needs to be replaced based on evidence of corrosion craters, replacement of an affected slider assembly is required by this AD but contacting Leonardo S.p.a. is not required by this AD.

(6) The “Remarks” section of EASA AD 2018–0292 does not apply to this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2018–0292 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Related Information

For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228–7330; email andrea.jimenez@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Aviation Safety Agency (EASA) AD 2018–0292, dated December 28, 2018.

(ii) [Reserved]

(3) For EASA AD 2018–0292, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADS@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N 321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0507.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 26, 2021.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–20827 Filed 9–24–21; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2021–0724; Project Identifier MCAI–2021–00321–R; Amendment 39–21723; AD 2021–19–05]

RIN 2120–AA64

Airworthiness Directives; Leonardo S.p.a. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Leonardo S.p.a. Model AB412 and AB412 EP helicopters. This AD was prompted by a report of a cracked hoist support assembly having a certain part number. This AD requires a one-time inspection of the hoist support assembly and, depending on the findings, replacement with a serviceable part, as specified in a European Union Aviation Safety Agency (EASA) Emergency AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective October 12, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 12, 2021.

The FAA must receive comments on this AD by November 12, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For EASA material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADS@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view the EASA material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of the EASA material at the FAA, call (817) 222–5110. The EASA material is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0724.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0724; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this

AD, the EASA AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Darren Gassetto, Aerospace Engineer, COS Program Management Section, FAA, Operational Safety Branch, Compliance & Airworthiness Division, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone (516) 228-7323; email Darren.Gassetto@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA Emergency AD 2021-0072-E, dated March 12, 2021 (EASA Emergency AD 2021-0072-E) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for Leonardo S.p.a. (formerly AgustaWestland S.p.A., Agusta S.p.A., and Costruzioni Aeronautiche Giovanni Agusta) Model AB412 and AB412 EP helicopters, all serial numbers.

This AD was prompted by a report of a cracked hoist support assembly having part number (P/N) 212-8800-02-1 on a Leonardo S.p.a. Model AB412 military helicopter. The investigation is still ongoing. This same part is installed on Leonardo S.p.a. Model AB412 civil helicopters. The FAA is issuing this AD to address cracking in a hoist support assembly which, if not addressed, could affect the structural integrity of the hoist support assembly, leading to in-flight detachment of the hoist assembly, and possibly resulting in damage to, and reduced control of, the helicopter. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

EASA Emergency AD 2021-0072-E specifies procedures for a one-time inspection of any hoist support assembly having P/N 212-8800-02-1 for cracking and, depending on the findings, replacement with a serviceable part. EASA Emergency AD 2021-0072-E also specifies reporting the inspection results to Leonardo S.p.a.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

These products have been approved by the aviation authority of another

country, and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD after evaluating all pertinent information and determining that the unsafe condition exists and is likely to exist or develop on other products of these same type designs.

Requirements of This AD

This AD requires accomplishing the actions specified in EASA Emergency AD 2021-0072-E, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities to use this process. As a result, EASA Emergency AD 2021-0072-E is incorporated by reference in this FAA final rule. This AD, therefore, requires compliance with EASA Emergency AD 2021-0072-E in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA Emergency AD 2021-0072-E that is required for compliance with EASA Emergency AD 2021-0072-E is available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0724.

Interim Action

The FAA considers this AD interim action. If final action is later identified, the FAA might consider further rulemaking then.

Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for "good cause" finds that those procedures are "impracticable, unnecessary, or contrary to the public interest." Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

There are currently no domestic operators of these products. Therefore, the FAA finds that notice and opportunity for prior public comment are unnecessary pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the foregoing reason, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0724; Project Identifier MCAI-2021-00321-R" at the beginning of your comments. The most helpful comments reference a specific portion of the AD, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this AD because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this AD.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and

that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Darren Gassetto, Aerospace Engineer, COS Program Management Section, FAA, Operational Safety Branch, Compliance & Airworthiness Division, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone (516) 228-7323; email Darren.Gassetto@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Regulatory Flexibility Act (RFA)

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

There are no costs of compliance with this AD because there are no helicopters with this type certificate on the U.S. Registry.

Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120-0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Pkwy., Fort Worth, TX 76177-1524.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue

rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this AD would not have federalism implications under Executive Order 13132. This AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2021-19-05 Leonardo S.p.a.: Amendment 39-21723; Docket No. FAA-2021-0724; Project Identifier MCAI-2021-00321-R.

(a) Effective Date

This airworthiness directive (AD) becomes effective October 12, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Leonardo S.p.a. Model AB412 and AB412 EP helicopters, certificated in any category.

(d) Subject

Joint Aircraft System Component (JASC) Codes 2500, Cabin Equipment/Furnishings; 2550, Cargo Compartments.

(e) Unsafe Condition

This AD was prompted by a report of a cracked hoist support assembly on a Leonardo S.p.a. Model AB412 military helicopter. The FAA is issuing this AD to address cracking in a hoist support assembly which, if not addressed, could affect the structural integrity of the hoist support assembly, leading to in-flight detachment of the hoist assembly, and possibly resulting in damage to, and reduced control of, the helicopter.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) Emergency AD 2021-0072-E, dated March 12, 2021 (EASA Emergency AD 2021-0072-E).

(h) Exceptions to EASA Emergency AD 2021-0072-E

(1) Where EASA Emergency AD 2021-0072-E refers to its effective date, this AD requires using the effective date of this AD.

(2) This AD does not require the "Remarks" section of EASA Emergency AD 2021-0072-E.

(i) Special Flight Permit

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the helicopter to a location where the helicopter can be modified (if the operator elects to do so), provided the hoist is not used until the inspection and any applicable corrective actions specified in paragraphs (1) and (2) of EASA Emergency AD 2021-0072-E are completed.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector,

or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Related Information

For more information about this AD, contact Darren Gassetto, Aerospace Engineer, COS Program Management Section, FAA, Operational Safety Branch, Compliance & Airworthiness Division, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone (516) 228-7323; email Darren.Gassetto@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) Emergency AD 2021-0072-E, dated March 12, 2021.

(ii) [Reserved]

(3) For EASA Emergency AD 2021-0072-E, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADS@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call 817-222-5110. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0724.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 31, 2021.

Gaetano A. Scirtino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-20826 Filed 9-24-21; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2021-0721; Project Identifier MCAI-2020-00616-R; Amendment 39-21713; AD 2021-18-12]

RIN 2120-AA64

Airworthiness Directives; PZL Swidnik S.A. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain PZL Swidnik S.A. Model PZL W-3A helicopters. This AD was prompted by a report of fractured hoist carrying assembly bracket (bracket) bolts. This AD requires repetitively inspecting the sealing compound of certain part-numbered brackets, and depending on the results, removing the hoist or removing the hardware from service and installing new hardware. As an option to replacing the bolts, this AD allows deactivating the hoist, turning the circuit breaker panel switches to the OFF position, installing inoperative placards on the circuit breaker panel switches, and before each flight, inspecting the sealing compound. This AD also establishes a life limit for the bracket bolts, and prohibits installing an affected hoist or an affected bracket and hoist unless the actions required by this AD have been accomplished. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective October 12, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain document listed in this AD as of October 12, 2021.

The FAA must receive comments on this AD by November 12, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building, Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this final rule, contact WSK "PZL-Swidnik" S.A., Al. Lotników Polskich 1, 21-045 Swidnik, Poland; telephone (+48) 81722 5716; fax (+48) 81722 5625; email: PL-CustomerSupport.AW@leonardocompany.com; or at <https://www.pzlswidnik.pl/en/home>. You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0721.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0721; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the European Union Aviation Safety Agency (EASA) AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Fred Guerin, Aerospace Engineer, General Aviation & Rotorcraft Section, International Validation Branch, Compliance & Airworthiness Division, FAA, 2200 S 216th St., Des Moines, WA 98198; telephone (202) 267-7457; email fred.guerin@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA Emergency AD 2019-0191-E, dated July 31, 2019 (EASA Emergency AD 2019-0191-E), to correct an unsafe condition for Wytwornia Sprzętu Komunikacyjnego (WSK) "PZL-Swidnik" Spółka Akcyjna (S.A.) Model PZL W-3A helicopters. EASA advises of a report of fractured bracket bolts. This condition, if not addressed, could result in detachment of the bracket resulting in movement of the hoist carrying assembly around the axis of the remaining two lower brackets, and subsequent damage to the helicopter and loss of hoisted load or person(s).

Accordingly, EASA Emergency AD 2019-0191-E requires repetitive inspections of the sealing compound around the affected brackets and, depending on the findings, accomplishing applicable corrective actions. EASA Emergency AD 2019-