

(i) S-92 Maintenance Manual, SA S92A-AMM-000, Temporary Revision (TR) 55-33, dated March 24, 2020.

(ii) [Reserved]

(4) For Sikorsky Aircraft Corporation service information identified in this AD, contact Sikorsky's Engineering Group at Sikorsky Aircraft Corporation, 124 Quarry Road, Trumbull, CT 06611, United States; phone: (800) 946-4337; email: wcs_cust_service_eng.gr-sik@lmco.com; website: www.sikorsky360.com.

(5) You may view this service information at FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fr.inspection@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on May 16, 2022.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-10952 Filed 5-20-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0518; Project Identifier MCAI-2021-00822-T; Amendment 39-22046; AD 2022-10-08]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus SAS Model A320-214, -251N, and -271N airplanes. This AD was prompted by reports that damaged seat rail covers were detected in the forward and aft seat fixation area of some airplanes during initial delivery. This AD requires a one-time detailed inspection of the affected passenger seats and corrective actions if necessary, as specified in a European Union Aviation Safety Agency (EASA). The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective June 7, 2022.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 7, 2022.

The FAA must receive comments on this AD by July 7, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0518.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0518; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email vladimir.ulyanov@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to

an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0518; Project Identifier MCAI-2021-00822-T" at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email vladimir.ulyanov@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0166, dated July 13, 2021 (EASA AD 2021-0166) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A320-214, -251N, and -271N airplanes.

This AD was prompted by reports that damaged seat rail covers were detected in the forward and aft seat fixation area of some airplanes during initial delivery. The FAA is issuing this AD to

address deformation or compression of the seat rail covers caused by improper transportation, handling or installation on the airplane. This condition, if not addressed, could lead to seat track detachment, possibly resulting in injury to passengers. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

EASA AD 2021–0166 specifies procedures for a detailed inspection of the affected parts and corrective actions. Corrective actions include replacement of the seat or the seat rail covers. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this AD after determining that the unsafe condition described previously is likely to exist or develop on other products of these same type designs.

Requirements of This AD

This AD requires accomplishing the actions specified in EASA AD 2021–0166 described previously, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, EASA AD 2021–0166 is incorporated by reference in this AD. This AD requires compliance with EASA AD 2021–0166 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021–0166 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2021–0166.

Service information required by EASA AD 2021–0166 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0518 after this AD is published.

FAA’s Justification and Determination of the Effective Date

There are currently no domestic operators of these products. Accordingly, notice and opportunity for prior public comment are unnecessary, pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the forgoing reason(s), the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

Regulatory Flexibility Act (RFA)

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

Currently, there are no affected U.S.-registered airplanes. If an affected airplane is imported and placed on the U.S. Register in the future, the FAA provides the following cost estimates to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

	Labor cost	Parts cost	Cost per product
2 work-hours × \$85 per hour = \$170		\$0	\$170

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need this on-condition action:

ESTIMATED COSTS OF ON-CONDITION ACTION

Action	Labor cost	Parts cost	Cost per product
Seat rail cover replacement	1 work-hour × \$85 per hour = \$85	Up to \$160	Up to \$245 (per rail cover).
Seat replacement	3 work-hours × \$85 per hour = \$255	Up to \$21,600	Up to \$21,855 (per seat).

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in

Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or

develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

(1) Is not a “significant regulatory action” under Executive Order 12866, and

(2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2022–10–08 Airbus SAS: Amendment 39–22046; Docket No. FAA–2022–0518; Project Identifier MCAI–2021–00822–T.

(a) Effective Date

This airworthiness directive (AD) is effective June 7, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A320–214, –251N, and –271N airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2021–0166, dated July 13, 2021 (EASA AD 2021–0166).

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

(e) Unsafe Condition

This AD was prompted by reports that damaged seat rail covers were detected in the forward and aft seat fixation area of some airplanes during initial delivery. The FAA is issuing this AD to address deformation or compression of the seat rail covers caused by improper transportation, handling or installation on the airplane. This condition, if not addressed, could lead to seat track detachment, possibly resulting in injury to passengers.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2021–0166.

(h) Exceptions to EASA AD 2021–0166

(1) Where EASA AD 2021–0166 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2021–0166 does not apply to this AD.

(3) Where paragraph (2) of EASA AD 2021–0166 specifies actions if “discrepancies are detected,” for this AD a discrepancy is an out-of-tolerance distance between the forward and aft attachment screws or a damaged (deformed or compressed) seat rail cover.

(4) Where paragraph (3) of EASA AD 2021–0166 allows deferral of certain actions “in accordance with the applicable instructions and limitations of Master Minimum Equipment List (M MEL) item 25–20–01A,” for this AD use “in accordance with the applicable instructions and limitations of FAA M MEL item 25–21–01 or equivalent instructions and limitations in the operator’s existing FAA-approved minimum equipment list (MEL).”

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2021–0166 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (j)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are

not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3229; email vladimir.ulyanov@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2021–0166, dated July 13, 2021.

(ii) [Reserved]

(3) For EASA AD 2021–0166, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on May 6, 2022.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–10867 Filed 5–20–22; 8:45 am]

BILLING CODE 4910–13–P