

since Boeing Service Bulletin 747-28A2261 was incorporated, or within 90 days after the effective date of this AD, whichever occurs latest.

(ii) For airplanes not identified in paragraph (g)(6)(i) of this AD: Within 12 months since AWL No. 28-AWL-23 was incorporated into the existing maintenance or inspection program, or within 12 months after the most recent inspection was performed as specified in AWL No. 28-AWL-23, whichever occurs later.

(7) For AWL No. 28-AWL-25, "Cushion Clamps and Teflon Sleeving Installed on Out-of-Tank Wire Bundles Installed on Brackets that are Mounted Directly on the Fuel Tanks": At the applicable time specified in paragraph (g)(7)(i) or (ii) of this AD.

(i) For airplanes that did not have any version of AWL No. 28-AWL-25 in the existing maintenance or inspection program before the effective date of this AD: Within 144 months since issuance of the original airworthiness certificate or original export certificate of airworthiness, or within 12 months after the effective date of this AD, whichever occurs later.

(ii) For airplanes not identified in paragraph (g)(7)(i) of this AD: Within 144 months since AWL No. 28-AWL-25 was incorporated into the existing maintenance or inspection program, within 144 months since Boeing Special Attention Service Bulletin 747-57-2327 was incorporated, or within 144 months after the most recent inspection was performed as specified in AWL No. 28-AWL-25, whichever occurs latest.

(8) For AWL No. 28-AWL-31, "Reserve Tank Refuel Valve Installation—Lightning Protection Electrical Bond": At the applicable time specified in paragraph (g)(8)(i) or (ii) of this AD.

(i) For airplanes that did not have any version of AWL No. 28-AWL-31 in the existing maintenance or inspection program before the effective date of this AD: Within 72 months since issuance of the original airworthiness certificate or original export certificate of airworthiness, or within 6 months after the effective date of this AD, whichever occurs later.

(ii) For airplanes not identified in paragraph (g)(8)(i) of this AD: Within 72 months since AWL No. 28-AWL-31 was incorporated into the existing maintenance or inspection program, or within 72 months after the most recent inspection was performed as specified in AWL No. 28-AWL-31, whichever occurs later.

(h) Differences From the Required Service Information

(1) Where the "Applicability" column of AWL Nos. 28-AWL-25 and 28-AWL-27 specifies "ALL" and "NOTE," replace that text with "Airplanes L/N 645 and on."

(2) In the "Description" column of AWL Nos. 28-AWL-25 and 28-AWL-27, remove the Applicability Note.

(i) Additional Acceptable Wire Types and Sleeving

(1) Where AWL No. 28-AWL-11 identifies wire types BMS 13-48, BMS 13-58, and BMS 13-60, the following wire types are acceptable: MIL-W-22759/16, SAE

AS22759/16 (M22759/16), MIL-W-22759/32, SAE AS22759/32 (M22759/32), MIL-W-22759/34, SAE AS22759/34 (M22759/34), MIL-W-22759/41, SAE AS22759/41 (M22759/41), MIL-W-22759/86, SAE AS22759/86 (M22759/86), MIL-W-22759/87, SAE AS22759/87 (M22759/87), MIL-W-22759/92, and SAE AS22759/92 (M22759/92); and MIL-C-27500 and NEMA WC 27500 cables constructed from these military or SAE specification wire types, as applicable.

(2) Where AWL No. 28-AWL-11 identifies TFE-2X Standard wall for wire sleeving, the following sleeving materials are acceptable: Roundit 2000NX and Varglas Type HO, HP, or HM.

(j) No Alternative Actions, Intervals, or Critical Design Configuration Control Limitations (CDCCLs)

After the existing maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections), intervals, or CDCCLs may be used unless the actions, intervals, and CDCCLs are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (l) of this AD.

(k) Terminating Action for Certain ADs

Accomplishment of the revision required by paragraph (g) of this AD terminates the requirements specified in paragraphs (k)(1) through (7) of this AD for that airplane:

(1) The revision required by paragraphs (g) and (h) of AD 2008-10-07 R1.

(2) The revision required by paragraph (g)(1) of AD 2008-18-09.

(3) The revision required by paragraph (h)(2) of AD 2010-13-12.

(4) The revision required by paragraph (h) of AD 2010-24-13.

(5) The revision required by paragraph (k) of AD 2011-06-03.

(6) The revision required by paragraph (h)(2) of AD 2014-15-14.

(7) The revision required by paragraph (h) of AD 2016-19-03.

(l) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (m)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration

deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(m) Related Information

(1) For more information about this AD, contact Rose Len, Aerospace Engineer, Propulsion Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3604; email: rose.len@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; phone: 562-797-1717; internet: <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on May 9, 2022.

Gaetano A. Scirtino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-11750 Filed 6-1-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0592; Project Identifier MCAI-2021-01023-T]

RIN 2120-AA64

Airworthiness Directives; MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain MHI RJ Aviation ULC Model CL-600-2D24 (Regional Jet Series 900) airplanes. This proposed AD was prompted by a report of a manufacturing error that can create dents on the lower wing plank, close to the flap arm locations at certain wing stations; as a result, cracks could develop and weaken the structural integrity of the wings before being detected by any existing required inspections. This proposed AD would require an inspection for damage (including dents, cracks, discoloration, gouges, scratches, or other surface damage) of the lower wing plank in the flap arm areas at certain wing stations, and repair if necessary. The FAA is

proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by July 18, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact MHI RJ Aviation Group, Customer Response Center, 3655 Ave. des Grandes-Tourelles, Suite 110, Boisbriand, Québec J7H 0E2 Canada; North America toll-free telephone 833-990-7272 or direct-dial telephone 450-990-7272; fax 514-855-8501; email thd.crj@mhirj.com; internet <https://mhirj.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0592; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Deep Gaurav, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-0592; Project Identifier MCAI-2021-01023-T” at the beginning of your comments. The most helpful

comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Deep Gaurav, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2021-31, dated September 14, 2021 (TCCA AD CF-2021-31) (also referred to after this as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain MHI RJ Aviation ULC Model CL-600-2D24 (Regional Jet Series 900) airplanes. You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0592.

This proposed AD was prompted by a report of a manufacturing error that can result in dents on the lower wing plank, close to the five flap arm locations at wing station (WS) 54.55, WS 128.00, WS 179.00, WS 220.00, and WS 264.00. These dents could lead to cracks that could weaken the structural integrity of the wings before being detected by any existing required inspection. The FAA is proposing this AD to address dents, cracks, and other damage, that if not detected and corrected, could lead to reduced structural integrity of the wings. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

MHI RJ Aviation ULC has issued Service Bulletin 670BA-57-029, dated February 2, 2021. This service information describes, among other actions, procedures for doing a detailed visual inspection for damage (including dents, cracks, discoloration, gouges, scratches, or other surface damage) of the outer aft lower skin at WS 54.55, WS 128.00, WS 179.00, WS 220.00, and WS 264.00, and repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 14 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
2 work-hours × \$85 per hour = \$170	\$0	\$170	\$2,380

The FAA has received no definitive data on which to base the cost estimates for the on-condition actions specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.):
Docket No. FAA–2022–0592; Project Identifier MCAI–2021–01023–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by July 18, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.) Model CL–600–2D24 (Regional Jet Series 900) airplanes, certificated in any category, having serial number 15462 through 15475 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report of a manufacturing error that can create dents on the lower wing plank, close to the flap arm locations at certain wing stations; as a result, cracks could develop and weaken the structural integrity of the wings before being detected by any existing required inspections. The FAA is issuing this AD to address dents, cracks, and other damage, that, if not detected and corrected, could lead to reduced structural integrity of the wings.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection and Corrective Action

Prior to the accumulation of 8,800 total flight hours or within 30 days after the effective date of this AD, whichever occurs later, perform a detailed visual inspection for damage (including dents, cracks, discoloration, gouges, scratches, or other surface damage) of the outer aft lower skin at wing stations (WS) 54.55, WS 128.00, WS 179.00, WS 220.00, and WS 264.00 in accordance with paragraph B., “Procedure,”

of the Accomplishment Instructions of MHI RJ Aviation Service Bulletin 670BA–57–029, dated February 2, 2021. Do all applicable corrective actions before further flight. If any damage is found during the inspection, before further flight, repair using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or MHI RJ Aviation ULC’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(h) No Reporting Requirement

Although MHI RJ Aviation Service Bulletin 670BA–57–029, dated February 2, 2021, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(i) Special Flight Permit

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the airplane to a location where the inspection can be done, provided the flight is a non-revenue flight.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or MHI RJ Aviation ULC’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF–2021–31, dated September 14, 2021, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0592.

(2) For more information about this AD, contact Deep Gaurav, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

(3) For service information identified in this AD, contact MHI RJ Aviation Group, Customer Response Center, 3655 Ave. des Grandes-Tourelles, Suite 110, Boisbriand, Québec J7H 0E2 Canada; North America toll-free telephone 833-990-7272 or direct-dial telephone 450-990-7272; fax 514-855-8501; email thd.crj@mhijrj.com; internet <https://mhijrj.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on May 24, 2022.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-11803 Filed 6-1-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0595; Project Identifier MCAI-2021-01180-T]

RIN 2120-AA64

Airworthiness Directives; Airbus Defense and Space S.A. (Formerly Known as Construcciones Aeronauticas, S.A.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) AD 2021-16-07, which applies to certain Airbus Defense and Space S.A. Model C-212-CB, C-212-CC, C-212-CD, C-212-CE, C-212-CF, C-212-DE, and C-212-DF airplanes. AD 2021-16-07 requires repetitive inspections of the left-hand (LH) and right-hand (RH) side center wing fairings at a certain frame, around the wing leading edge for discrepancies (cracks), and repair if necessary. Since the FAA issued AD 2021-16-07, a modification was developed to reinforce the structure in the affected area, providing an optional terminating action for the repetitive inspections required by AD 2021-16-07. This proposed AD would continue to require the actions in AD 2021-16-07 and would allow new optional

terminating action for the repetitive inspections, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by July 18, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0595.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0595; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3220; email shahram.daneshmandi@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-0595; Project Identifier MCAI-2021-01180-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3220; email shahram.daneshmandi@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2021-16-07, Amendment 39-21669 (86 FR 47210, August 24, 2021) (AD 2021-16-07), which applies to certain Airbus Defense and Space S.A. Model C-212-CB, C-