

§ 875.410 May I continue my coverage when I leave Federal or military service?

If you are an active workforce member, your coverage will automatically continue when you leave active service, as long as the Carrier continues to receive the required premium when due.

■ 21. Revise § 875.413 to read as follows:

§ 875.413 Is it possible to have coverage reinstated?

(a) Under certain circumstances, your coverage can be reinstated. The Carrier will reinstate your coverage if it receives proof satisfactory to it, within 6 months from the date of the written notice of termination, that you suffered from a cognitive impairment or loss of functional capacity, before the grace period ended, that caused you to miss making premium payments. In that event, you will not be required to submit to underwriting. Your coverage will be reinstated retroactively to the termination date but you must pay back premiums for that period. The premium will be the same as it was prior to termination.

(b) If your coverage has terminated because you did not pay premiums or because you requested cancellation, the Carrier may reinstate your coverage within 12 months from the date of the written notice of termination at your request. You will be required to reapply based on full underwriting, and the Carrier will determine whether you are still insurable. If you are insurable, your coverage will be reinstated retroactively to the termination date and you must pay back premiums for that period. The premium will be the same as it was prior to termination.

[FR Doc. 2022-11720 Filed 6-2-22; 8:45 am]

BILLING CODE P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2022-0514; Project Identifier AD-2022-00357-E]

RIN 2120-AA64

Airworthiness Directives; General Electric Company Turbofan Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for

certain General Electric Company (GE) GEnx-1B model turbofan engines. This proposed AD was prompted by several reports of fuel leaks caused by high cycle fatigue (HCF) cracks found at the braze joints on fuel manifolds, and the subsequent manufacturer redesign of the high-pressure turbine (HPT) fuel hose variable stator vane (VSV) manifold, VSV fuel hose manifold, low-pressure turbine (LPT) fuel hose variable bleed valve (VBV) manifold, and VBV fuel hose manifold. This proposed AD would require removal and replacement of the fuel hydraulic lines. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by July 18, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact General Electric Company, 1 Neumann Way, Cincinnati, OH 45215; phone: (513) 552-3272; email: aviation.fleetsupport@ge.com; website: www.ge.com. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0514; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Alexei Marqueen, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238-7178; email: Alexei.T.Marqueen@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0514; Project Identifier AD-2022-00357-E" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Alexei Marqueen, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA received reports of fuel manifold leaks resulting in multiple flight delays and cancellations on four separate occasions between 2018 and 2021 on airplanes with GEnx-1B model turbofan engines installed. The manufacturer's investigation revealed that variations in braze coverage and braze fillet radii caused high stress concentration factors at the braze block

joints, leading to HCF failure in the tube bundles with brazed joints. As a result of its investigation, the manufacturer determined that the HPT fuel hose VSV manifold, VSV fuel hose manifold, LPT fuel hose VBV manifold, and VBV fuel hose manifold required redesign by replacing all braze features and cushioned clamps with block clamps. The manufacturer published GE GENx-1B Service Bulletin 73-0099 R00, dated February 28, 2022, which specifies procedures for the replacement of fuel hydraulic lines with redesigned fuel hydraulic lines. This condition, if not addressed, could result in engine fire and damage to the airplane.

FAA’s Determination

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Related Service Information Under 14 CFR Part 51

The FAA reviewed GE GENx-1B Service Bulletin 73-0099 R00, dated February 28, 2022. This service information specifies procedures for the removal and replacement of the fuel hydraulic lines. This service information is reasonably available because the interested parties have

access to it through their normal course of business or by the means identified in **ADDRESSES**.

Proposed AD Requirements in This NPRM

This proposed AD would require the removal and replacement of the fuel hydraulic lines.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 298 engines installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Remove fuel hydraulic lines	2 work-hours × \$85 per hour = \$170	\$0	\$170	\$50,660
Install redesigned fuel hydraulic lines	2.5 work-hours × \$85 per hour = \$212.50	232,000	232,212.50	69,199,325

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

General Electric Company: Docket No. FAA-2022-0514; Project Identifier AD-2022-00357-E.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by July 18, 2022.

(b) Affected ADs

None.

(c) Applicability

General Electric Company (GE) GENx-1B64, GENx-1B64/P1, GENx-1B64/P2, GENx-1B67, GENx-1B67/P1, GENx-1B67/P2, GENx-1B70, GENx-1B70/75/P1, GENx-1B70/75/P2, GENx-

1B70/P1, GENx-1B70/P2, GENx-1B70C/P1, GENx-1B70C/P2, GENx-1B74/75/P1, GENx-1B74/75/P2, GENx-1B76/P2, and GENx-1B76A/P2 model turbofan engines with engine serial numbers 956-102 through 958-775, inclusive, 958-795, and 958-802.

(d) Subject

Joint Aircraft System Component (JASC) Code 7310, Engine Fuel Distribution.

(e) Unsafe Condition

This AD was prompted by several reports of fuel leaks caused by high cycle fatigue cracks found at the braze joints on certain GENx-1B fuel manifolds. The FAA is issuing this AD to prevent fuel leaks on the variable bypass valve and variable stator vane fuel hose manifolds. The unsafe condition, if not addressed, could result in engine fire and damage to the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

At the next engine shop visit after the effective date of this AD, remove and replace the fuel hydraulic lines using the Accomplishment Instructions, paragraphs 3.A and 3.B, of GE GENx-1B Service Bulletin (SB) 73-0099 R00, dated February 28, 2022.

(h) Definition

For the purpose of this AD, an “engine shop visit” is the induction of an engine into the shop for maintenance involving the separation of pairs of major mating engine case flanges, except for the following situations, which do not constitute an engine shop visit:

- (1) Separation of engine flanges solely for the purposes of transportation of the engine without subsequent maintenance.

(2) Separation of engine flanges solely for the purposes of replacing the fan or propulsor without subsequent maintenance.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD and email to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

(1) For more information about this AD, contact Alexei Marqueen, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238-7178; email: Alexei.T.Marqueen@faa.gov.

(2) For service information identified in this AD, contact General Electric Company, 1 Neumann Way, Cincinnati, OH 45215; phone: (513) 552-3272; email: aviation.fleetsupport@ge.com; website: www.ge.com. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110.

Issued on May 5, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-11896 Filed 6-2-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2022-0694; Airspace Docket No. 22-ACE-12]

RIN 2120-AA66

Proposed Amendment of Class D and Class E Airspace and Establishment of Class E Airspace; Columbia, MO

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This action proposes to amend the Class D and Class E airspace and establish Class E airspace at Columbia, MO. The FAA is proposing

this action as the result of a biennial airspace review. The geographic coordinates of the airport would also be updated to coincide with the FAA's aeronautical database.

DATES: Comments must be received on or before July 18, 2022.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590; telephone (202) 366-9826, or (800) 647-5527. You must identify FAA Docket No. FAA-2022-0694/Airspace Docket No. 22-ACE-12 at the beginning of your comments. You may also submit comments through the internet at <https://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays.

FAA Order JO 7400.11F, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at https://www.faa.gov/air_traffic/publications/. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

FOR FURTHER INFORMATION CONTACT:

Jeffrey Claypool, Federal Aviation Administration, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5711.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would amend the Class D airspace, the Class E surface airspace, and the Class E airspace extending upward from 700 feet above the surface and establish Class E airspace designated as an extension to Class D and Class E surface airspace at Columbia Regional Airport,

Columbia, MO, to support instrument flight rule operations at this airport.

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal. Communications should identify both docket numbers and be submitted in triplicate to the address listed above. Commenters wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. FAA-2022-0694/Airspace Docket No. 22-ACE-12." The postcard will be date/time stamped and returned to the commenter.

All communications received before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this notice may be changed in light of the comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

Availability of NPRMs

An electronic copy of this document may be downloaded through the internet at <https://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's web page at https://www.faa.gov/air_traffic/publications/airspace_amendments/.

You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for the address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined during normal business hours at the Federal Aviation Administration, Air Traffic Organization, Central Service Center, Operations Support Group, 10101 Hillwood Parkway, Fort Worth, TX 76177.