

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by June 13, 2024.

**(b) Affected ADs**

None.

**(c) Applicability**

(1) This AD applies to The Boeing Company Model 757-200, -200CB, and -200PF series airplanes specified in paragraph (c)(1)(i) or (ii) of this AD, certificated in any category.

(i) Airplanes identified in Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023.

(ii) Airplanes converted to a freighter configuration using VT MAE Supplemental Type Certificate (STC) ST03562AT, ST03952AT, or ST04242AT.

(2) Installation of STC ST01518SE does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01518SE is installed, a "change in product" alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by a report indicating an operator has found cracks on three Model 757-200PF airplanes at the main deck cargo door cutout forward and aft hinge attachment holes. The FAA is issuing this AD to detect and correct cracks in the main deck cargo door hinge area. Undetected cracks in the main deck cargo door hinge area could result in reduced structural integrity of the aircraft.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

(1) For the airplanes identified in paragraph (c)(1)(i) of this AD: Except as specified by paragraph (h) of this AD, at the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023.

**Note 1 to paragraph (g)(1):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 757-53A0106, dated January 3, 2023, which is referred to in Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023.

(2) For the airplanes identified in paragraph (c)(1)(ii) of this AD: Within 30 days after the effective date of this AD, do a maintenance record check for any repair at the forward and aft hinge areas of the main deck cargo door cutout and obtain inspection instructions and applicable repair

instructions using a method approved by the Manager, AIR-520, Continued Operational Safety Branch, FAA. Comply with all applicable instructions at the time specified in the instructions.

**(h) Exceptions to Service Information Specifications**

(1) Where the Compliance Time columns of the tables in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023, use the phrase the original issue date of Requirements Bulletin 757-53A0106 RB, this AD requires using the effective date of this AD.

(2) Where Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023, specifies contacting Boeing for repair instructions or for alternative inspections, this AD requires doing the repair, or doing the alternative inspections and applicable on-condition actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [AMOC@faa.gov](mailto:AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR-520, Continued Operational Safety Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(j) Related Information**

(1) For more information about this AD, contact Wayne Ha, Aviation Safety Engineer, FAA, 2200 South 216th Street, Des Moines, WA 98198; phone: 562-627-5238; email: [wayne.ha@faa.gov](mailto:wayne.ha@faa.gov).

(2) Service information identified in this AD that is not incorporated by reference is available at the address specified in paragraph (k)(3) of this AD.

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Requirements Bulletin 757-53A0106 RB, dated January 3, 2023.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website [myboeingfleet.com](http://myboeingfleet.com).

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locations](http://www.archives.gov/federal-register/cfr/ibr-locations) or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on April 23, 2024.

**Victor Wicklund,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2024-09019 Filed 4-26-24; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2024-1009; Project Identifier MCAI-2023-01221-T]**

**RIN 2120-AA64**

**Airworthiness Directives; MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain MHI RJ Aviation ULC Model CL-600-2D15 (Regional Jet Series 705) and CL-600-2D24 (Regional Jet Series 900) airplanes. This proposed AD was prompted by a report that torque wrenches used during production installation of bulkhead fittings on the oxygen lines of the flight crew oxygen mask stowage boxes and adapter fitting on the oxygen pressure gauge were out of calibration during production installation, which resulted in a higher torque level setting than required. This proposed AD would require replacement of the affected oxygen line fittings, as specified in a Transport Canada AD, which is proposed for

incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by June 13, 2024.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *regulations.gov*. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**AD Docket:** You may examine the AD docket at *regulations.gov* under Docket No. FAA-2024-1009; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

**Material Incorporated by Reference:**

- For Transport Canada material that is proposed for IBR in this AD, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email *TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca*. You may find this material on the Transport Canada website at *tc.canada.ca/en/aviation*. It is also available at *regulations.gov* under Docket No. FAA-2024-1009.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**FOR FURTHER INFORMATION CONTACT:** Fatin Saumik, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email *Fatin.R.Saumik@faa.gov*.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2024-1009; Project Identifier

MCAI-2023-01221-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

##### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Fatin Saumik, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email *Fatin.R.Saumik@faa.gov*. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

##### Background

Transport Canada, which is the aviation authority for Canada, has issued Transport Canada AD CF-2023-75, dated November 28, 2023 (Transport Canada AD CF-2023-75) (also referred to as the MCAI), to correct an unsafe condition for certain MHI RJ Aviation ULC Model CL-600-2D15 (Regional Jet Series 705) and CL-600-2D24 (Regional Jet Series 900) airplanes. The MCAI states MHI RJ Aviation ULC received a quality escape notice from a supplier, reporting that torque wrenches used during production installation of bulkhead fittings on the oxygen lines of the flight crew oxygen mask stowage

boxes and adapter fitting on the oxygen pressure gauge were out of calibration, which resulted in a higher torque level setting than required by drawing. This over-torque could cause damage to the oxygen line fittings which, if not corrected, could cause oxygen leakage before being annunciated and result in lack of oxygen to the flight crew when needed. The FAA is proposing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2024-1009.

##### Related Service Information Under 14 CFR Part 51

The FAA reviewed Transport Canada AD CF-2023-75, dated November 28, 2023, which specifies procedures for replacement of the bulkhead fittings on the oxygen lines of the mask stowage boxes and replacement of the fitting adapter on the oxygen pressure gauge. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

##### FAA’s Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

##### Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in Transport Canada AD CF-2023-75 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

##### Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate Transport Canada AD CF-2023-75 by reference in the FAA final

rule. This proposed AD would, therefore, require compliance with Transport Canada AD CF-2023-75 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this

proposed AD. Service information required by Transport Canada AD CF-2023-75 for compliance will be available at *regulations.gov* under Docket No. FAA-2024-1009 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 24 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

| Labor cost                                 | Parts cost | Cost per product | Cost on U.S. operators |
|--|------------|------------------|------------------------|
| 6 work-hours × \$85 per hour = \$510 ..... | \$350      | \$860            | \$20,640               |

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:  
**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.):**  
 Docket No. FAA-2024-1009; Project Identifier MCAI-2023-01221-T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by June 13, 2024.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to MHI RJ Aviation ULC (Type Certificate previously held by Bombardier, Inc.) Model CL-600-2D15 (Regional Jet Series 705) and CL-600-2D24 (Regional Jet Series 900) airplanes, certificated in any category, as identified in Transport Canada AD CF-2023-75, dated November 28, 2023 (Transport Canada AD CF-2023-75).

**(d) Subject**

Air Transport Association (ATA) of America Code 35, Oxygen.

**(e) Unsafe Condition**

This AD was prompted by a report that torque wrenches used during production installation of bulkhead fittings on the oxygen lines of the flight crew oxygen mask stowage boxes and adapter fitting on the oxygen pressure gauge were out of calibration, which resulted in a higher torque level setting than required. The FAA is issuing this AD to address this over-torque, which could cause damage to the oxygen line fittings. The unsafe condition, if not addressed, could result in oxygen leakage

before being annunciated and result in lack of oxygen to the flight crew when needed.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, Transport Canada AD CF-2023-75.

**(h) Exception to Transport Canada AD CF-2023-75**

- (1) Where Transport Canada AD CF-2023-75 refers to its effective date, this AD requires using the effective date of this AD.
- (2) Where Transport Canada AD CF-2023-75 refers to hours air time, this AD requires using flight hours.

**(i) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, mail it to the address identified in paragraph (j) of this AD. Information may be emailed to: *9-AVS-NYACO-COS@faa.gov*. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; Transport Canada; or MHI RJ Aviation ULC’s Transport Canada Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(j) Additional Information**

For more information about this AD, contact Fatin Saumik, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite

410, Westbury, NY 11590; telephone 516-228-7300; email [Fatin.R.Saumik@faa.gov](mailto:Fatin.R.Saumik@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Transport Canada AD CF-2023-75, dated November 28, 2023.

(ii) [Reserved]

(3) For Transport Canada AD CF-2023-75, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email [TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca](mailto:TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca). You may find this Transport Canada AD on the Transport Canada website at [tc.canada.ca/en/aviation](http://tc.canada.ca/en/aviation).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locations](http://www.archives.gov/federal-register/cfr/ibr-locations), or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on April 20, 2024.

#### Victor Wicklund,

Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2024-09016 Filed 4-26-24; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2024-1285; Project Identifier MCAI-2023-01146-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2023-05-08, which applies to certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. AD 2023-05-08

requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. Since the FAA issued AD 2023-05-08, the FAA has determined that new or more restrictive airworthiness limitations are necessary. This proposed AD would continue to require certain actions in AD 2023-05-08 and require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this NPRM by June 13, 2024.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2024-1285; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

#### *Material Incorporated by Reference:*

- For Airbus Canada Limited Partnership material, contact Airbus Canada Limited Partnership, 13100 Henri-Fabre Boulevard, Mirabel, Québec J7N 3C6, Canada; telephone 450-476-7676; email [a220](mailto:a220) website [a220world.airbus.com](http://a220world.airbus.com).

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

#### **FOR FURTHER INFORMATION CONTACT:**

Gabriel D. Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7343; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

#### **SUPPLEMENTARY INFORMATION:**

#### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2024-1285; Project Identifier MCAI-2023-01146-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](http://regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Gabriel D. Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590, telephone 516-228-7343; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov). Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

The FAA issued AD 2023-05-08, Amendment 39-22377 (88 FR 20751, April 7, 2023) (AD 2023-05-08), for certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. AD 2023-05-08 requires revising the existing maintenance or inspection program, as