

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2024–13–01 Bombardier, Inc.:** Amendment 39–22775; Docket No. FAA–2024–0467; Project Identifier MCAI–2023–00892–T.

**(a) Effective Date**

This airworthiness directive (AD) is effective August 16, 2024.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Bombardier, Inc., Model CL–600–2B16 (604 Variant) airplanes, certificated in any category, serial numbers 5775 through 5990 inclusive and 6050 through 6178 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 28, Fuel.

**(e) Unsafe Condition**

This AD was prompted by a report of sparking due to damaged wire insulation in the fueling adapter. The FAA is issuing this AD to address damaged wire insulation. The unsafe condition, if not addressed, could lead

to electrical sparks during refueling and possibly result in a fire.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspections**

Within 48 months after the effective date of this AD: Inspect the electrical wires attached to the J274 connector for damage, in accordance with Section 2.B of the Accomplishment Instructions of the applicable Bombardier service bulletin referenced in figure 1 to paragraph (g) of this AD.

FIGURE 1 TO PARAGRAPH (g)—APPLICABLE SERVICE BULLETINS

Model	Serial No.	Service bulletin
CL–600–2B16 .....	5775 through 5990 inclusive .....	Bombardier Service Bulletin 605–28–014, dated May 10, 2023.
CL–600–2B16 .....	6050 through 6178 inclusive .....	Bombardier Service Bulletin 650–28–003, dated May 10, 2023.

**(h) Related Investigative and Corrective Actions**

Before further flight after accomplishing paragraph (g) of this AD, do the applicable actions specified in paragraph (h)(1) or (2) of this AD.

(1) If no electrical wire is damaged, do the related investigative and corrective actions specified in and in accordance with Section 2.C of the Accomplishment Instructions of the applicable Bombardier service bulletin referenced in figure 1 to paragraph (g) of this AD.

(2) If any electrical wire is damaged, do the related investigative and corrective actions specified in and in accordance with Section 2.D of the Accomplishment Instructions of the applicable Bombardier service bulletin referenced in figure 1 to paragraph (g) of this AD.

**(i) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, mail it to the address identified in paragraph (j) of this AD. Information may be emailed to: [9-AVS-NYACO-COS@faa.gov](mailto:9-AVS-NYACO-COS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or Transport Canada; or Bombardier, Inc.'s Transport Canada Design Approval Organization (DAO). If approved by

the DAO, the approval must include the DAO-authorized signature.

**(j) Additional Information**

For more information about this AD, contact Steven Dzierzynski, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7300; email: [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 605–28–014, dated May 10, 2023.

(ii) Bombardier Service Bulletin 650–28–003, dated May 10, 2023.

(3) For service information, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; phone 514–855–2999; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); website [bombardier.com](http://bombardier.com).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locationsoremailfr.inspection@nara.gov](http://www.archives.gov/federal-register/cfr/ibr-locationsoremailfr.inspection@nara.gov).

Issued on June 18, 2024.

**James D. Foltz,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2024–15306 Filed 7–11–24; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA–2024–0998; Project Identifier MCAI–2023–01212–T; Amendment 39–22778; AD 2024–13–04]**

**RIN 2120–AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 7X airplanes. This AD was prompted by a determination that non-conforming washers may have been installed in production on engine 1 and 3 forward yokes. This AD requires a one-time inspection for non-conforming washers and, depending on findings, related investigative and corrective actions, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective August 16, 2024.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 16, 2024.

**ADDRESSES:**

*AD Docket:* You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA–2024–0998; or in person at Docket Operations between 9 a.m. and

5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**Material Incorporated by Reference:**

- For EASA material, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu). It is also available at [regulations.gov](http://regulations.gov) under Docket No. FAA-2024-0998.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 206-231-3226; email [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Background**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Dassault Aviation Model FALCON 7X airplanes. The

NPRM published in the **Federal Register** on April 9, 2024 (89 FR 24748). The NPRM was prompted by AD 2023-0208, dated November 22, 2023 (EASA AD 2023-0208) (also referred to as the MCAI), issued by EASA, which is the Technical Agent for the Member States of the European Union. The MCAI states that a quality review revealed that nonconforming washers may have been installed in production on engine 1 and 3 forward yokes. This condition, if not addressed, could lead to cracks in the bolts and the engine forward yokes, possibly resulting in loss of a lateral engine.

In the NPRM, the FAA proposed to require a one-time inspection for non-conforming washers and, depending on findings, related investigative and corrective actions, as specified in EASA AD 2023-0208. The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2024-0998.

**Discussion of Final Airworthiness Directive**

**Comments**

The FAA received no comments on the NPRM or on the determination of the cost to the public.

**Conclusion**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's

bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on this product. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

**Related Material Under 1 CFR Part 51**

EASA AD 2023-0208 specifies procedures for a one-time inspection for non-conforming (non-compliant) double countersink washers on the engine 1 and 3 forward yokes, installing the engine 1 and 3 forward yokes with new attachments, and, depending on findings, related investigative and corrective actions. Related investigative and corrective actions include a special detailed fatigue inspection for cracking of the engine forward yokes and replacement if any cracking is found. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**Costs of Compliance**

The FAA estimates that this AD affects 8 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
8 work-hours × \$85 per hour = \$680 .....	\$16,280	\$16,960	\$135,680

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need these on-condition actions:

**ESTIMATED COSTS OF ON-CONDITION ACTIONS**

Labor cost	Parts cost	Cost per product
8 work-hours × \$85 per hour = \$680 .....	\$33,170	\$33,850

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected operators.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing

regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

#### 2024–13–04 Dassault Aviation:

Amendment 39–22778; Docket No. FAA–2024–0998; Project Identifier MCAI–2023–01212–T.

#### (a) Effective Date

This airworthiness directive (AD) is effective August 16, 2024.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Dassault Aviation Model FALCON 7X airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD

2023–0208, dated November 22, 2023 (EASA AD 2023–0208).

#### (d) Subject

Air Transport Association (ATA) of America Code 71, Powerplant.

#### (e) Unsafe Condition

This AD was prompted by a determination that non-conforming washers may have been installed in production on engine 1 and 3 forward yokes. The FAA is issuing this AD to address a condition that could lead to cracks in the bolts and the engine forward yokes. The unsafe condition, if not addressed, could result in loss of a lateral engine.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2023–0208.

#### (h) Exceptions to EASA AD 2023–0208

(1) Where paragraph (2) of EASA AD 2023–0208 specifies to “accomplish the corrective actions,” replace that text with “accomplish a special detailed fatigue inspection to detect cracking of the engine forward yoke, and replace before further flight if any cracking is found.”

(2) This AD does not adopt the “Remarks” section of EASA AD 2023–0208.

#### (i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, mail it to the address identified in paragraph (j) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Dassault Aviation’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (j) Additional Information

For more information about this AD, contact Tom Rodriguez, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 206–231–3226; email: [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023–0208, dated November 22, 2023.

(ii) [Reserved]

(3) For EASA AD 2023–0208, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this EASA AD on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locations](http://www.archives.gov/federal-register/cfr/ibr-locations), or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on June 24, 2024.

**James D. Foltz,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2024–15305 Filed 7–11–24; 8:45 am]

**BILLING CODE 4910–13–P**

## FEDERAL TRADE COMMISSION

### 16 CFR Part 436

### Disclosure Requirements and Prohibitions Concerning Franchising

**AGENCY:** Federal Trade Commission.

**ACTION:** Final rule.

**SUMMARY:** The Federal Trade Commission (“FTC” or “Commission”) announces revised monetary thresholds for three exemptions from the Franchise Rule. The FTC is required to adjust the size of the monetary thresholds every fourth year based upon changes in the Consumer Price Index for All Urban Consumers (“CPI-U”) published by the Department of Labor.

**DATES:** This final rule is effective July 12, 2024.

**FOR FURTHER INFORMATION CONTACT:** Christine M. Todaro, Attorney, Division of Marketing Practices, Bureau of Consumer Protection, Federal Trade Commission, 600 Pennsylvania Avenue NW, Washington, DC 20580, phone: 202–326–3711, email: [ctodaro@ftc.gov](mailto:ctodaro@ftc.gov).

**SUPPLEMENTARY INFORMATION:** The FTC’s Trade Regulation Rule entitled “Disclosure Requirements and